

TECHNICAL DATA SHEET



Cyclo Industries, Inc

401 Maplewood Dr • Jupiter, FL 33458 • 561-775-9600

Surface Insensitive Threadlocker-Blue

C-24350

PRODUCT DESCRIPTION

Cyclo® Surface Insensitive Threadlocker-Blue is a **medium strength** anaerobic threadlocking material, which cures between engaged threads to form a unitized assembly that helps resist leakage, shock and vibration. The product is a one component, anaerobic liquid that cures when confined in the absence of air between close fitting metal surfaces. Ideal for all 1/4 inch to 3/4 inch diameter nut and bolt assemblies, achieving significant strength even in the presence of light oils. Excellent chemical resistance and a temperature resistance range of -54°C to +149°C (-65°F to +300°F). Easily removable with hand tools for servicing requirements.

PRODUCT BENEFITS

Improved Reliability

- Eliminates vibration issues
- Seals against leakage
- Prevents rusting of threads
- Cures without cracking or shrinking
- Adjusts or disassembles with hand tools

Easy Application

- No mixing
- No curing outside of joint
- Resists dripping from threads during assembly
- No torque compensation required during assembly

TYPICAL APPLICATIONS

Prevents loosening and leakage of threaded fasteners. Particularly suitable for applications such as:

- Belt tensioner bolts
- Pulley bolts
- Cup and core plugs
- Fan hub bolts
- Visor mount bolts
- Starter mounting bolts
- Alternator Mounting Bolts
- Intake Manifold Bolts
- Valve Cover Bolts
- Vacuum Adjustment Screws
- Oil Pan Bolts
- Axle Cover Screws
- Drive Shaft Bolts
- Disc Brake Caliper Bolts

DIRECTIONS FOR USE

For assembly

1. Clean all threads (Bolt and Hole) with a cleaning solvent such as compliant **Cyclo®** Brake and Parts Cleaner and allow to dry.
2. Determine if the threads to be bonded are **Active** or **Inactive Metals** (Ref: Cure Speed vs. Substrate on the

second page). If material is an **Inactive Metal**, spray all threads with **Cyclo®** C-930 Surface Preparation and allow 30 seconds to dry. Priming is not required if the material is

an **Active Metal**. If unknown, it's always best to use the activator.

3. Shake the product thoroughly before use.
4. To prevent the product from clogging in the nozzle, do not allow the tip to touch metal surfaces during application.
5. **For Thru Holes**, apply several drops of product onto the bolt at the nut engagement area.
6. **For Blind Holes**, also apply several drops down the female threads into the bottom of the hole. As threads are engaged, compressed air forces the product upwards into the threads.
7. Assemble and tighten as usual. When tightening to established torque values, torque compensation is not required.

For Cleanup

1. Residual liquid films and/or fillets outside the joint are readily soluble in compliant **Cyclo®** Brake and Parts Cleaner.
2. Cured product can be removed with a combination of soaking in **Cyclo®** Gasket Remover and mechanical abrasion such as a wire brush.

For Disassembly

1. Remove with standard hand tools.
2. In the rare instance where hand tools do not work, because of excessive engagement length, apply localized heat to nut or bolt to approximately 232°C (450°F). Disassemble while hot.

For Reassembly

1. Remove loose product from nut and bolt.
2. Apply primer to all threads, regardless of metal type.
3. Assemble and tighten as usual.

PROPERTIES OF UNCURED MATERIAL

	Typical Value
Appearance	Opaque Blue Fluorescent Liquid
Specific Gravity	1.08
Viscosity @ 25 C, mPa.s cP	1,500 to 3,000
Brookfield RVF, spindle #3, @ 20 RPM	
Flash Point (TCC), C (F)	>93 (>200)

PERFORMANCE OF CURED MATERIAL

(After 24 hr at 72_F on 3/8-16 steel Grade 8 Nuts and Grade 5 bolts)

	Typical Value	Range
Breakaway Torque, Nm, (in.lbs)	21 (186)	15 to 25 (130 to 220)
Prevail Torque, Nm (in.lbs)	6 (53)	4 to 10 (35 to 88)

Where Breakaway Torque is the force required to initiate the fastener movement and Prevail Torque is the force required to disassemble the

DISCLAIMER: Cyclo Industries, Inc. provides the information contained herein in good faith but makes no representation as to its comprehensiveness or accuracy. Individuals receiving this information must exercise their independent judgment in determining its appropriateness for a particular purpose. Cyclo Industries, Inc. makes no representations or warranties, either expressed or implied, of merchantability, fitness for a particular purpose with respect to the information set forth herein or to the product to which the information refers. Accordingly, Cyclo Industries, Inc. will not be responsible for damages resulting from use of or reliance upon this information.

TECHNICAL DATA SHEET



Cyclo Industries, Inc

401 Maplewood Dr • Jupiter, FL 33458 • 561-775-9600

Surface Insensitive Threadlocker-Blue

C-24350

fastener once Breakaway Torque has occurred.

TYPICAL CURING PERFORMANCE


Cure speed vs. substrate

The rate of cure will depend on the material used. Cyclo® Surface Insensitive Threadlocker-Blue will react faster and

stronger with **Active Metals**. However, **Inactive Metals** will require the use of an activator (Cyclo® C-930 Surface Preparation) to obtain maximum strength and cure speed at room temperature.

Active Metals	Inactive Metals
Soft Steel Iron	Bright Platings
Copper	Anodized Surfaces
Brass	Titanium
Manganese	Zinc
Bronze	Pure Aluminum
Nickel	Stainless Steel
Aluminum Alloy	Cadmium

The graph below shows the breakaway strength developed with time on 3/8" - 16 Grade 5 bolts and Grade 8 nuts compared to different materials.

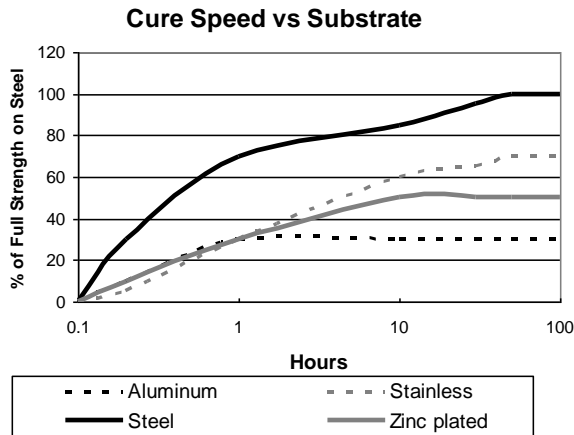

Cure speed vs. temperature


The rate of cure will depend on the ambient temperature. Full cure is attainable in 24 hours at room temperature, 22°C (72°F), or 1 hour at 93°C (200°F).

Cure speed vs. activator

Where cure speed is unacceptably long, or large gaps are present, applying an activator (Cyclo® C-930 Surface Preparation) to the surface will improve cure speed. A 3/8-16 steel nut and bolt assembly will fixture in about 5 minutes using an activator, while fixturing will occur in about 20 minutes

without an activator. Full cure in 24 hours for both procedures. The graph below shows the breakaway strength developed with time using Cyclo® C-930 Surface Preparation.

Cure Speed vs Activator

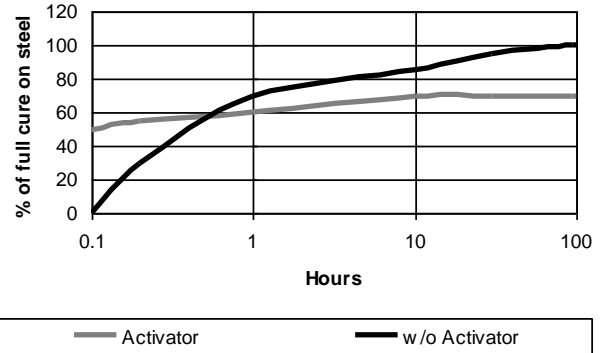

TYPICAL ENVIRONMENTAL RESISTANCE

Temperature Resistance

Product temperature range from -54°C to +149°C (-65°F to +300°F). The breakaway and prevailing torque values decrease as temperature increases, however the assembly remains effective against vibration and leakage.

Chemical / Solvent Resistance

Aged under conditions and tested at 22°C(72°F)

% Initial Strength retained after time

Temp	500hr	1000hr
Gasoline 23°C	110%	
Antifreeze 87°C	90%	
Ethanol 23°C	75%	
Acetone 23°C	15%	
Hot air 150°C		35%
Motor oil(SL) 125°C		95%

GENERAL INFORMATION

Technical Data Sheet Surface Insensitive Threadlocker-Blue Blue

This product is not recommended for use in pure oxygen and/or oxygen rich systems and should not be selected as a sealant for chlorine or other strong oxidizing materials. For safe handling information on this product, consult the Material Safety Data Sheet, (MSDS).

This product is not normally recommended for use on plastics (particularly thermoplastic materials where stress cracking of the plastic could result). It is recommended to confirm compatibility of the product with such substrates.

ORDERING INFORMATION

Part Number	Container Size
C-24350	50 ml bottle

STORAGE

Products shall be ideally stored in a cool, dry location in

DISCLAIMER: Cyclo Industries, Inc. provides the information contained herein in good faith but makes no representation as to its comprehensiveness or accuracy. Individuals receiving this information must exercise their independent judgment in determining its appropriateness for a particular purpose. Cyclo Industries, Inc. makes no representations or warranties, either expressed or implied, of merchantability, fitness for a particular purpose with respect to the information set forth herein or to the product to which the information refers. Accordingly, Cyclo Industries, Inc. will not be responsible for damages resulting from use of or reliance upon this information.

TECHNICAL DATA SHEET



Cyclo Industries, Inc

401 Maplewood Dr • Jupiter, FL 33458 • 561-775-9600

Surface Insensitive Threadlocker-Blue

C-24350

unopened containers at a temperature between 8_ to 28_ C (46_ to 82_ F) unless otherwise labeled. Optimal storage is at the lower half of this temperature range. To prevent contamination of unused product, do not return any material to its original container.

DISCLAIMER: Cyclo Industries, Inc. provides the information contained herein in good faith but makes no representation as to its comprehensiveness or accuracy. Individuals receiving this information must exercise their independent judgment in determining its appropriateness for a particular purpose. Cyclo Industries, Inc. makes no representations or warranties, either expressed or implied, of merchantability, fitness for a particular purpose with respect to the information set forth herein or to the product to which the information refers. Accordingly, Cyclo Industries, Inc. will not be responsible for damages resulting from use of or reliance upon this information.