



Cyclo Industries, Inc

401 Maplewood Dr • Jupiter, FL 33458 • 561-775-9600

TECHNICAL DATA SHEET

Fast Cure Gasket Maker-Red

C-51850

PRODUCT DESCRIPTION

Cyclo® Fast Cure Gasket Maker-Red is a single component, medium strength, thixotropic, anaerobic sealant that cures rapidly. The product cures when confined in the absence of air between close fitting aluminum surfaces. It provides a tough, resilient, solvent and temperature resistant seal that flexes with flange movement caused by vibration, pressurization or thermal changes.

PRODUCT BENEFITS

- No mixing
- No curing outside of joint
- Non-corrosive to aluminum or cast iron parts

TYPICAL APPLICATIONS

Used for sealing flexible metal machined assemblies. Typically used as a form-in-place gasket on rigid flanged connections, e.g. Gearbox and engine castings.

DIRECTIONS FOR USE

1. Surfaces to be sealed should be free of grease, oil and dirt. Use a compliant Cyclo® Brake and Parts Cleaner to remove oil. Use Cyclo® Gasket Remover to remove old gaskets.
2. Apply manually to one side of flange, making sure a continuous bead is applied.
3. Assemble parts.
4. Torque to normal specifications.
5. Parts may be returned to service in one hour.

For Cleanup

1. Wipe off excess material with a clean cloth.
2. Clean hands with soap and water.

For Disassembly

1. For smaller assembled parts, heat part to 400°F to 450°F.
2. Use cautious, light prying or tapping motion to loosen the parts. Repeat heating/prying sequence as needed.
3. For larger assembled parts use prying/cleaving tools in combination with a light hammer and cautiously tap and pry the sides of the part to break the gasketed surfaces loose.
4. Once parts are disassembled, allow all surfaces to cool to room temperature.
5. Use Cyclo® Gasket Remover to remove dried anaerobic material.


PHYSICAL PROPERTIES

	Typical Value
Appearance	Red Gel
Odor	Acrid
Specific Gravity	1.13
Viscosity cP	800,000/3,750,000 Thixotropic
Gap cure (inch)	0.010 diametral (Unprimed) 0.050 diametral (Primed)
Cure Speed (Hours)	1hr-12 hr (Unprimed) 15 Minutes – 2 hr(Primed)
Flash Point (°F)	>200

TYPICAL CURING PERFORMANCE

Cure Speed vs. Substrate

The rate of cure will depend on the substrate used. The graph below shows the shear strength developed with time on grit blasted steel lap shears compared to different materials and tested according to ASTM D 1002.

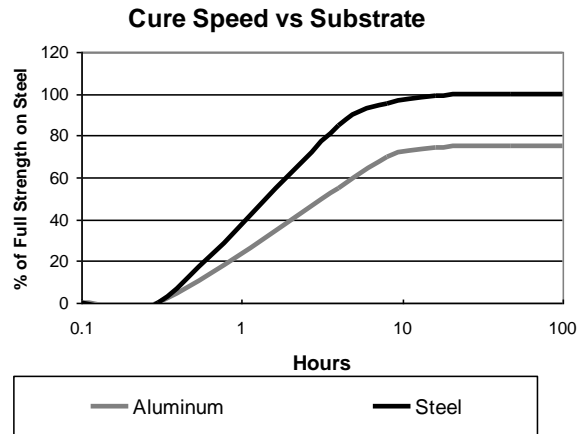

Cure Speed vs. Activator

Where cure speed is unacceptably long, or large gaps are present, applying activator to the surface will improve cure speed. The graph below shows the shear strength developed with time using Cyclo® C-930 Surface Preparation Activator on grit blasted steel lap shears and tested according to ASTM D 1002.

DISCLAIMER: Cyclo Industries, Inc. provides the information contained herein in good faith but makes no representation as to its comprehensiveness or accuracy. Individuals receiving this information must exercise their independent judgment in determining its appropriateness for a particular purpose. Cyclo Industries, Inc. makes no representations or warranties, either expressed or implied, of merchantability, fitness for a particular purpose with respect to the information set forth herein or to the product to which the information refers. Accordingly, Cyclo Industries, Inc. will not be responsible for damages resulting from use of or reliance upon this information.



Cyclo Industries, Inc


401 Maplewood Dr • Jupiter, FL 33458 • 561-775-9600

TECHNICAL DATA SHEET

Fast Cure Gasket Maker-Red

C-51850

Cure Speed vs Activator

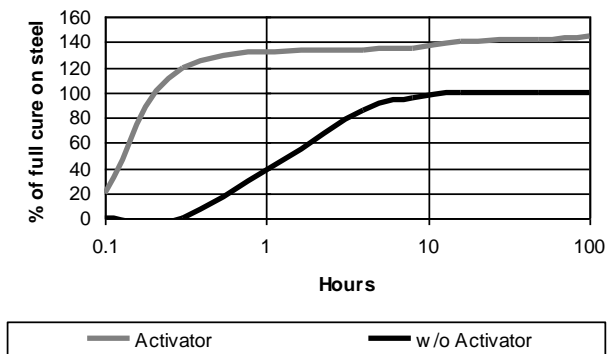

GENERAL INFORMATION

This product is not recommended for use in pure oxygen and/or oxygen rich systems and should not be selected as a sealant for chlorine or other strong oxidizing materials.

For safe handling information on this product, consult the Material Safety Data Sheet, (MSDS).

ORDERING INFORMATION

Part Number

C-51850

Container Size

50 ml. tube

STORAGE

Products shall be ideally stored in a cool, dry location in unopened containers at a temperature between 8°C to 28°C (46°F to 82°F) unless otherwise labeled. Optimal storage is at the lower half of this temperature range. To prevent contamination of unused product, do not return any material to its original container.

DISCLAIMER: Cyclo Industries, Inc. provides the information contained herein in good faith but makes no representation as to its comprehensiveness or accuracy. Individuals receiving this information must exercise their independent judgment in determining its appropriateness for a particular purpose. Cyclo Industries, Inc. makes no representations or warranties, either expressed or implied, of merchantability, fitness for a particular purpose with respect to the information set forth herein or to the product to which the information refers. Accordingly, Cyclo Industries, Inc. will not be responsible for damages resulting from use of or reliance upon this information.